

Back to [Daytona LE Menu](#)

November 14, 1996

SEGA GameWorks

Service Bulletin

"This Bulletin applies to the Daytona LE Games only"

Problem : No Feedback from the Steering Motor


Cause : Mis-wiring of the connector at CN5 of the I/O Board.

Correction : Perform the test listed below, and follow the appropriate instructions.

1. Put Machine into " Drive BD Test "
2. Read the value next to the line " Handle = ". If it is " FF " then proceed with the steps below . If the value is at or near " 80 " then your machine is fine, and no correction is necessary.

Steps to correct wiring problem

1. Turn Power Off. Open the PC Board Cage and locate the I/O Board (837-10539)
2. Locate CN5 and unplug it from the board (See Figure 1)
3. Move the White / Black Wire from Pin 11 of that connector to Pin 12. (See Figure 2)
4. Re-install the connector , and power up your machine to verify proper operation. Close up machine.

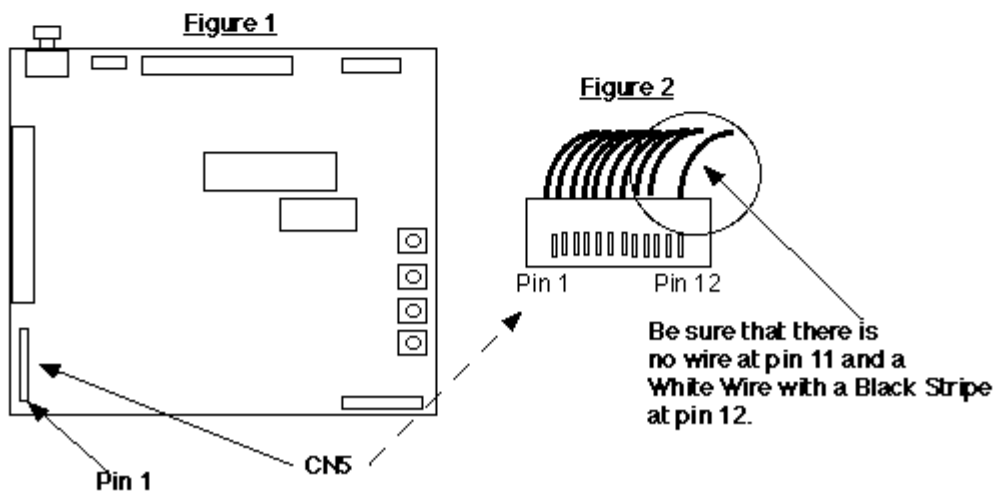

For further information , contact your Sega Distributor, or Sega Technical Services at (415) 802-1750 7:30am-4:30pm Pacific