

SEGA ENTERPRISES USA INC. Service Bulletin

"This Bulletin applies to the Gunblade Deluxe Ser #s 47000 - 47263 Only "

Problem : Gun site does not move in accordance with the gun body's movements.

Cause : Incorrect back-lash adjustment between the Fan Gear & Pinion Gear for the Left / Right motion of the gun. Caused stripping of the gears' teeth.

Correction : Following the instructions below, adjust the back-lash of the gears on the gun

1. Remove Side Covers L & R (8ea screws secure these).
2. Remove the Mech Side Cover L & R (11ea screws secure these).
3. Remove the Hide Plate (2ea screws secure this).
4. Loosen (Do not Remove) the 2ea Phillips Screws that secure the VR Bracket to allow it to be moved.
Move the bracket to adjust the backlash in a manner that allows the gears to properly mate, but not tight enough to cause binding. See figure
5. To reassemble, reverse the above steps.

